


6LED SINGLE COLOUR LIGHTHEAD

Surface Mount

- To + VDC (fuse @ 3A):.....**RED**
- To Chassis Ground:.....**BLACK**
- For Synchronisation and
Flash Pattern:.....**YELLOW**

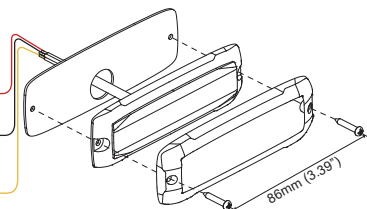

For Synchronisation:

Connect **YELLOW** wires of all heads together for synchronisation
(All heads should be set at the same Flash Pattern)

For Simultaneous or Alternating Flash:

1. Apply +VDC to **RED** and **YELLOW** wires simultaneously to enter Grouping mode;
lighthead will display short (single or double) flashes:
 - Single flash = Group1
 - Double flash = Group2
2. Remove **YELLOW** wire from +VDC and momentarily apply to +VDC to change Groups:
 - Heads in the same Group flash together.
 - Group1 Heads alternate with Group2 heads.

For Flash Pattern, momentarily
apply +VDC to **YELLOW** wire:

- once for next pattern
- quick three times to reset to FP#1
(see flash pattern chart)

Flash Patterns			
1	Double(R65)	9	Double (SAE)
2	Single(2Hz)	10	Triple (SAE)
3	Triple(2Hz)	11	Quad (SAE)
4	Quad(2Hz)	12	Quint (SAE)
5	Random	13	Ultra (SAE)
6	Steady	14	Single-Quad
7	Single(SAE)(CA13)	15	Single H/L
8	Mega	16	Singe-Triple-Quint